




# КОМПЛЕКТАЦІЯ ТА МОНТАЖ РЕЛЕЙНИХ БЛОЧНИХ СТАТИВІВ

B11

B21

	1	2	3	4	5	6	7	8	
	<i>M10BC</i>	<i>M14BC</i>	<i>M18BC</i>	<i>M20BC</i>	<i>8AII3</i>	<i>4/8ПЗ</i>	<i>4/8ПКС</i>	<i>OM10C</i>	
	HMШM1-1120	HMШM1-1120	HMШM1-1120	HMШM1-1120	HMШ4-2400	HMШM4-2400	HMШ4-3	HMШ2-4000	
	1	2	3	4					
6	<i>M22</i>	<i>M22</i>	<i>M22</i>	<i>M22</i>	Стр. 8		<i>8СП</i>		
	MI	HM1	HM1	HM1	С		СП69		
5	<i>M14</i>	<i>M14</i>	<i>M14</i>	<i>M14</i>	Стр. 2		<i>4/8 П</i>		
	MI	HM1	HM1	HM1	С		СП69		
4	<i>M10</i>	<i>M10</i>	<i>M10</i>	<i>M10</i>	Стр. 4		<i>2-4 СП</i>		
	MI	HM1	HM1	HM1	С		СП69		
3	<i>M20</i>	<i>M20</i>	<i>M20</i>	<i>M20</i>	Стр. 2, 4		<i>8AII</i>		
	MI	HM1	HM1	HM1	НСО×2		СП69		
2	<i>M2</i>	<i>M2</i>	<i>M2</i>	<i>M2</i>	<i>M18</i>		<i>M18</i>		
	II	HMIIП	HMIIП	HMIIП	HMIIП		MI1		
1	<i>M4</i>	<i>M4</i>	<i>M4</i>	<i>M4</i>	<i>M6</i>		<i>M6</i>		
	MI1	HMIIП	HMIIП	HMIIП	HMIIП		MI1		
Занятые выводы по типам									
8					<i>B5</i>	<i>B6</i>	<i>B7</i>	<i>B8</i>	Статив 34
20	<i>B11</i>	<i>B12</i>	<i>B13</i>	<i>B15</i>	<i>B16</i>	<i>B17</i>	<i>B9</i>	<i>B210</i>	
	<i>B12</i>	<i>B22</i>	<i>B23</i>	<i>B24</i>	<i>B25</i>	<i>B26</i>			
	<i>B1</i>	<i>B2</i>							
Шины	<i>Ш2</i>	<i>Ш3</i>	<i>Ш4</i>	<i>Ш5</i>	<i>Ш6</i>	<i>Ш7</i>			
	<i>М</i>	<i>СФ</i>	<i>П</i>	<i>СХ</i>	<i>М</i>	<i>П</i>			

# Монтажна схема верхніх панелей статива

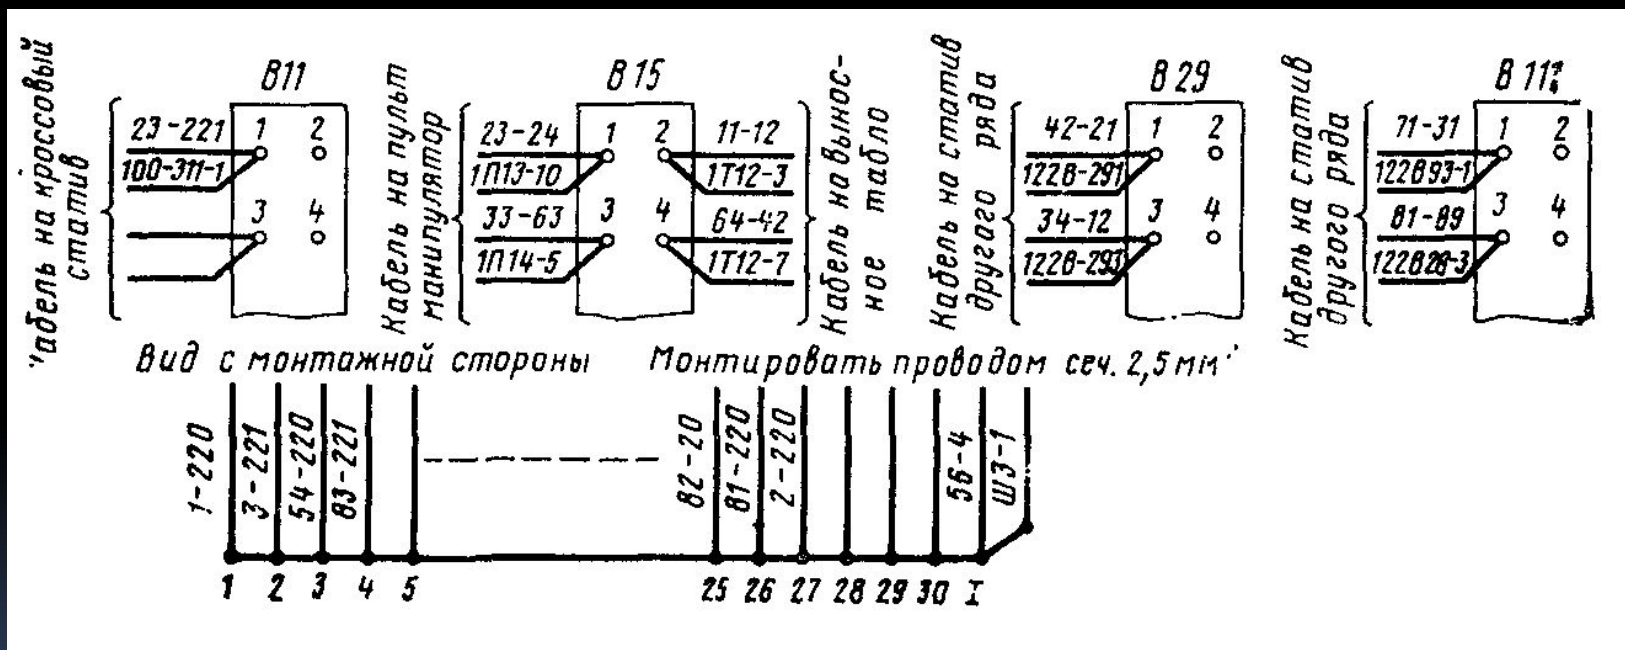

4					3					
4/8 П(СП-69)					стр. 2(С)					
222	1-222 64-222	CXM	122	B 12-6	222	B21-16		122	B26-4	
221			121		221	B11-12		121		
220	Ш-1	CX	120	76-4	220	B21-4		120	B26-6	
219	42-221		119	Ш4-4	П	219	B21-14	119		
218	64-218 44-218	2KCX	118			218		118		
217	41-219		117			217		117		
216			116	64-116 44-116	2MM	216	33-119	116	11-26	
215	44-221		115			215	33-14	115	11-25	
214			114	44-113		214	33-214	114	11-24	
213	2-221		113	64-114		213	B12-7	113	11-23	
212			112	Ш4-5	П	212	B12-9	112	11-22	
211	1-219		111			211	Ш-2	CX	111	11-21
210	44-210 1-211	РП	110	Ш6-3	М	210	B12-5	110	Ш6-4	М
29	1-221		19	B11-12		29	19	19	29 B26-2	
28			18	B11-8		28		18	43-28	
27			17	B11-18		27		17	43-27	
26	41-26		16	1-26		26	212-26	16	43-26	
25	41-25		15	1-25		25	21-25	15	43-25	
24	41-24		14	1-24		24	21-24	14	43-24	
23	41-23		13	1-23		23	21-23	13	43-23	
22	41-22		12	1-22		22	21-22	12	43-22	
21	41-21		11	77-4		21	21-21	11	43-21	

2					1						
M14(HM1)					M14(M1)						
222			122	Ш4-23	П	222	4-222 41-222	CXM	122	B15-10	
221	4-213		121	42-122 62-122	МИ	221	4-29		121		
220	Ш-27	CX	120			220	Ш-28	CX	120	41-120 61-120	ПОВ
219	72-63		119	B17-1		219	4-211		119	B11-15	
218	32-218 B2-3	ИHM	118	42-118 62-118	ПГ	218	41-218 61-218	ГОТ	118	61-118 41-118	ПMB
217	64-219		117	1-117		217	64-215		117	2-117	
216			116	211 32-211	ИЧЧМ	216	41-216 61-216	МВ1	116	41-116 61-116	МГОТ
215	42-215 62-215	ПБ	115	1-115		215	64-217		115	2-115	
214	32-214	HM	114	62-114 42-114	МГ	214			114	41-114 61-114	МMB
213			113	76-11		213			113	72-42	
212	32-212 64-118		112	Ш4-24	П	212	B23-12		112	Ш4-25	П
211	116 B2-2	HMЧМ	111	1-111		211	61-211 4-210	РП	111	72-52 2-111	
210	42-210 62-210	ПН	110	Ш6-25	М	210	B23-10		110	Ш6-26	М
29	B17-3		19	72-33		29	B26-5		19	72-31	
28			18			28			18	72-21	
27	1-27		17	B17-5		27	2-27		17		
26	62-16 42-16	ВЧМ	16	62-26 42-26	ВHM	26	4-16		16	63-26	
25			15	42-15 62-15		25	4-15		15	63-15	
24	B9-7		14	42-14		24	4-14		14	63-14	
23	B9-9		13	42-13		23	4-13		13	63-23	
22	32-22 62-22		12	42-12		22	4-12		12	63-22	
21	B9-11		11	42-11		21	77-1		11	63-21	